

NOTE:
R.H. WIRING SHOWN/
L.H. WIRING RE-
VERSE YELLOW AND
BLUE WIRES

24 VAC
COIL

(SEE INSTRUCTIONS)
REMOTE INDICATOR RUN-TIME
WHEN REQUIRED
OR/BL OR


MAX RUN
& TDM

(OPTIONAL)
TIMER TO
CLOSE

OVERLOAD

ON/OFF
SWITCH

TERMINAL STRIP
ON ELECTRIC PLATE

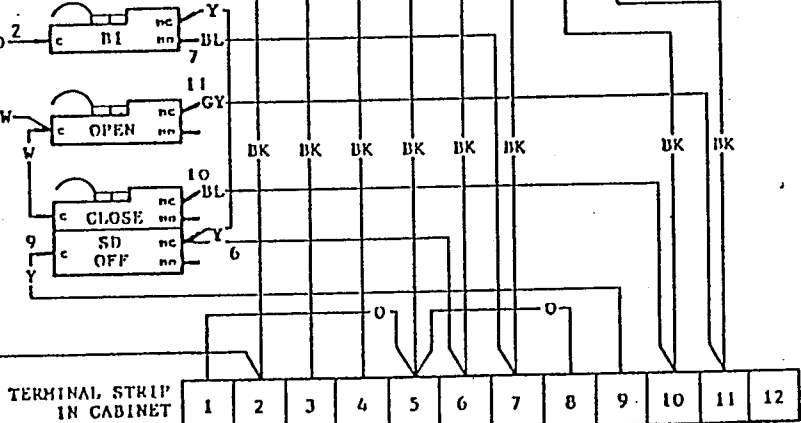

INCOMING LINE
L1 - NEUTRAL (115 V ONLY)
L2 - HOT LEG

WIRED FOR:
V-1Ø

NOTE:

- 1 - WIRE 15 NOT USED WHEN EXTERNAL INTERLOCK, L/O OR STOP BUTTON IS USED.
- 2 - TIMER DEFEAT SWITCH, WHEN USED, CONNECTS ACROSS TERMINALS 18 & 19. CLOSING SWITCH DISABLES TIMER.
- A - TREADLES, PULL SWITCHES, KEY SWITCHES, WANDS, PHOTO-ELECTRIC DEVICES, ETC. MAY BE CONNECTED TO TERMINALS INDICATED.
- B - REMOTE CONTROL UNITS (EXCLUDING TREADLES AND PHOTO-ELECTRIC UNITS), PULL SWITCHES AND SINGLE CONTACT CONTROL STATIONS, MAY BE CONNECTED TO TERMINALS INDICATED.

TERMINALS #3 & #4 PROVIDE 24 VAC FOR ACCESSORIES

WARNING: DO NOT SHORT TERMINALS #3 and #4

COMMERCIAL SWING GATE OPERATOR	
MTR/CNTR: 1Ø	
DATE: 4-27-82	REV 11 10-91
BY: R.L.	Dr. by: J.D.
OPTIONAL: TIMER TO CLOSE IN DASHED LINES	
WIRING DIAGRAM NO. 331-DR MRT	
FOR MODEL CSW SINGLE, MASTER/SLAVE.	